


PP1015TX/PS1015TX Install Instructions

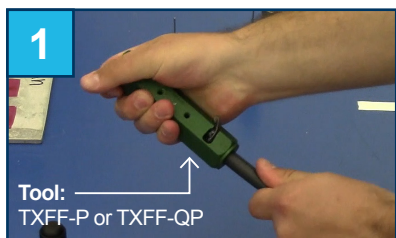

1
Tool: TXFF-P or TXFF-QP
Insert the cable into the first cut side of the coring tool and rotate the tool several times until you hit the stop in the tool.




2
Flip the coring tool to the second cut side, and insert the cable into the coring tool. Rotate the tool several times to strip off the jacket.




3
If using tri-shield cable, peel the exposed foil layer off, using pliers to assist if needed.



4
Peel back the exposed braid to ensure the connector can be installed smoothly.

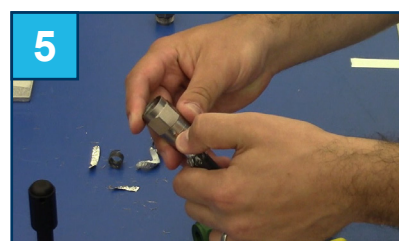


5
Use the second mark on the connector to measure your center conductor length.

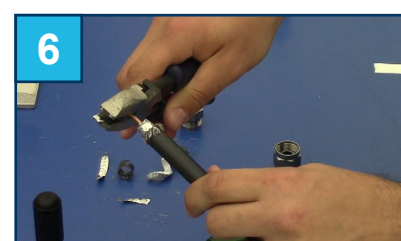

6
Trim center conductor at the measured length.



7
Guide the cable into the back nut and ensure it's properly seated before applying force.

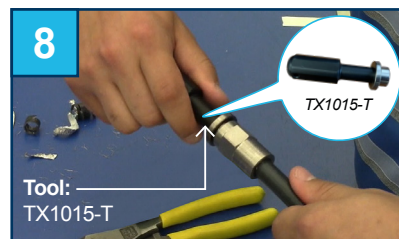

8
Tool: TX1015-T
Use an insertion tool to aid in the installation. Continue to push and rotate the tool until the connector is fully installed.



9
Proper installation is when you can visually ensure the dielectric is flush with the end of the connector.



10
Insert the front body of the connector into the equipment. Hand tighten, and use an adjustable wrench to tighten another 1/8 to 1/4 turn.



11
Guide the center conductor of your prepped connector into the front body and insert until it clicks together.



12
Hand tighten the connector, then use two adjustable wrenches to fully tighten until positive stop.

Part Number	Description
PP1015TX	Pin Connector, Flex Feeder 500 (1015TX)
PS1015TX	Splice Connector, Flex Feeder 500 (1015TX)
PP1015FMTX	F-Male Connector, Flex Feeder 500 (1015FMTX)
TXFF-P	MegaDrop Cable Stripper for Standard/Tri Cable
TXFF-QP	MegaDrop Cable Stripper for Quad Cable
TX1015-T	Connector Insertion Tool

This product may be protected by one or more patents • For further information, please visit: www.ppc-online.com/patents

6176 E. Molloy Rd. East Syracuse, NY 13057 U.S.A. • customerservice@ppc-online.com • 1-800-800-6652 • +1 315-431-7200 • www.ppc-online.com